



境川橋震害圖

ELEVATION & PLAN OF SAKAIGAWA

Showing the condition after the earthquake disaster of Oct. 28th,
All the piers, each consisting of a couple of cast iron screw piles, 2'6" in diameter and filled with concrete, broken

Scale 10 ft. = 1 inch.



境川橋震害圖(其一)

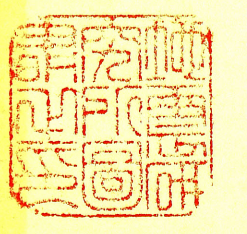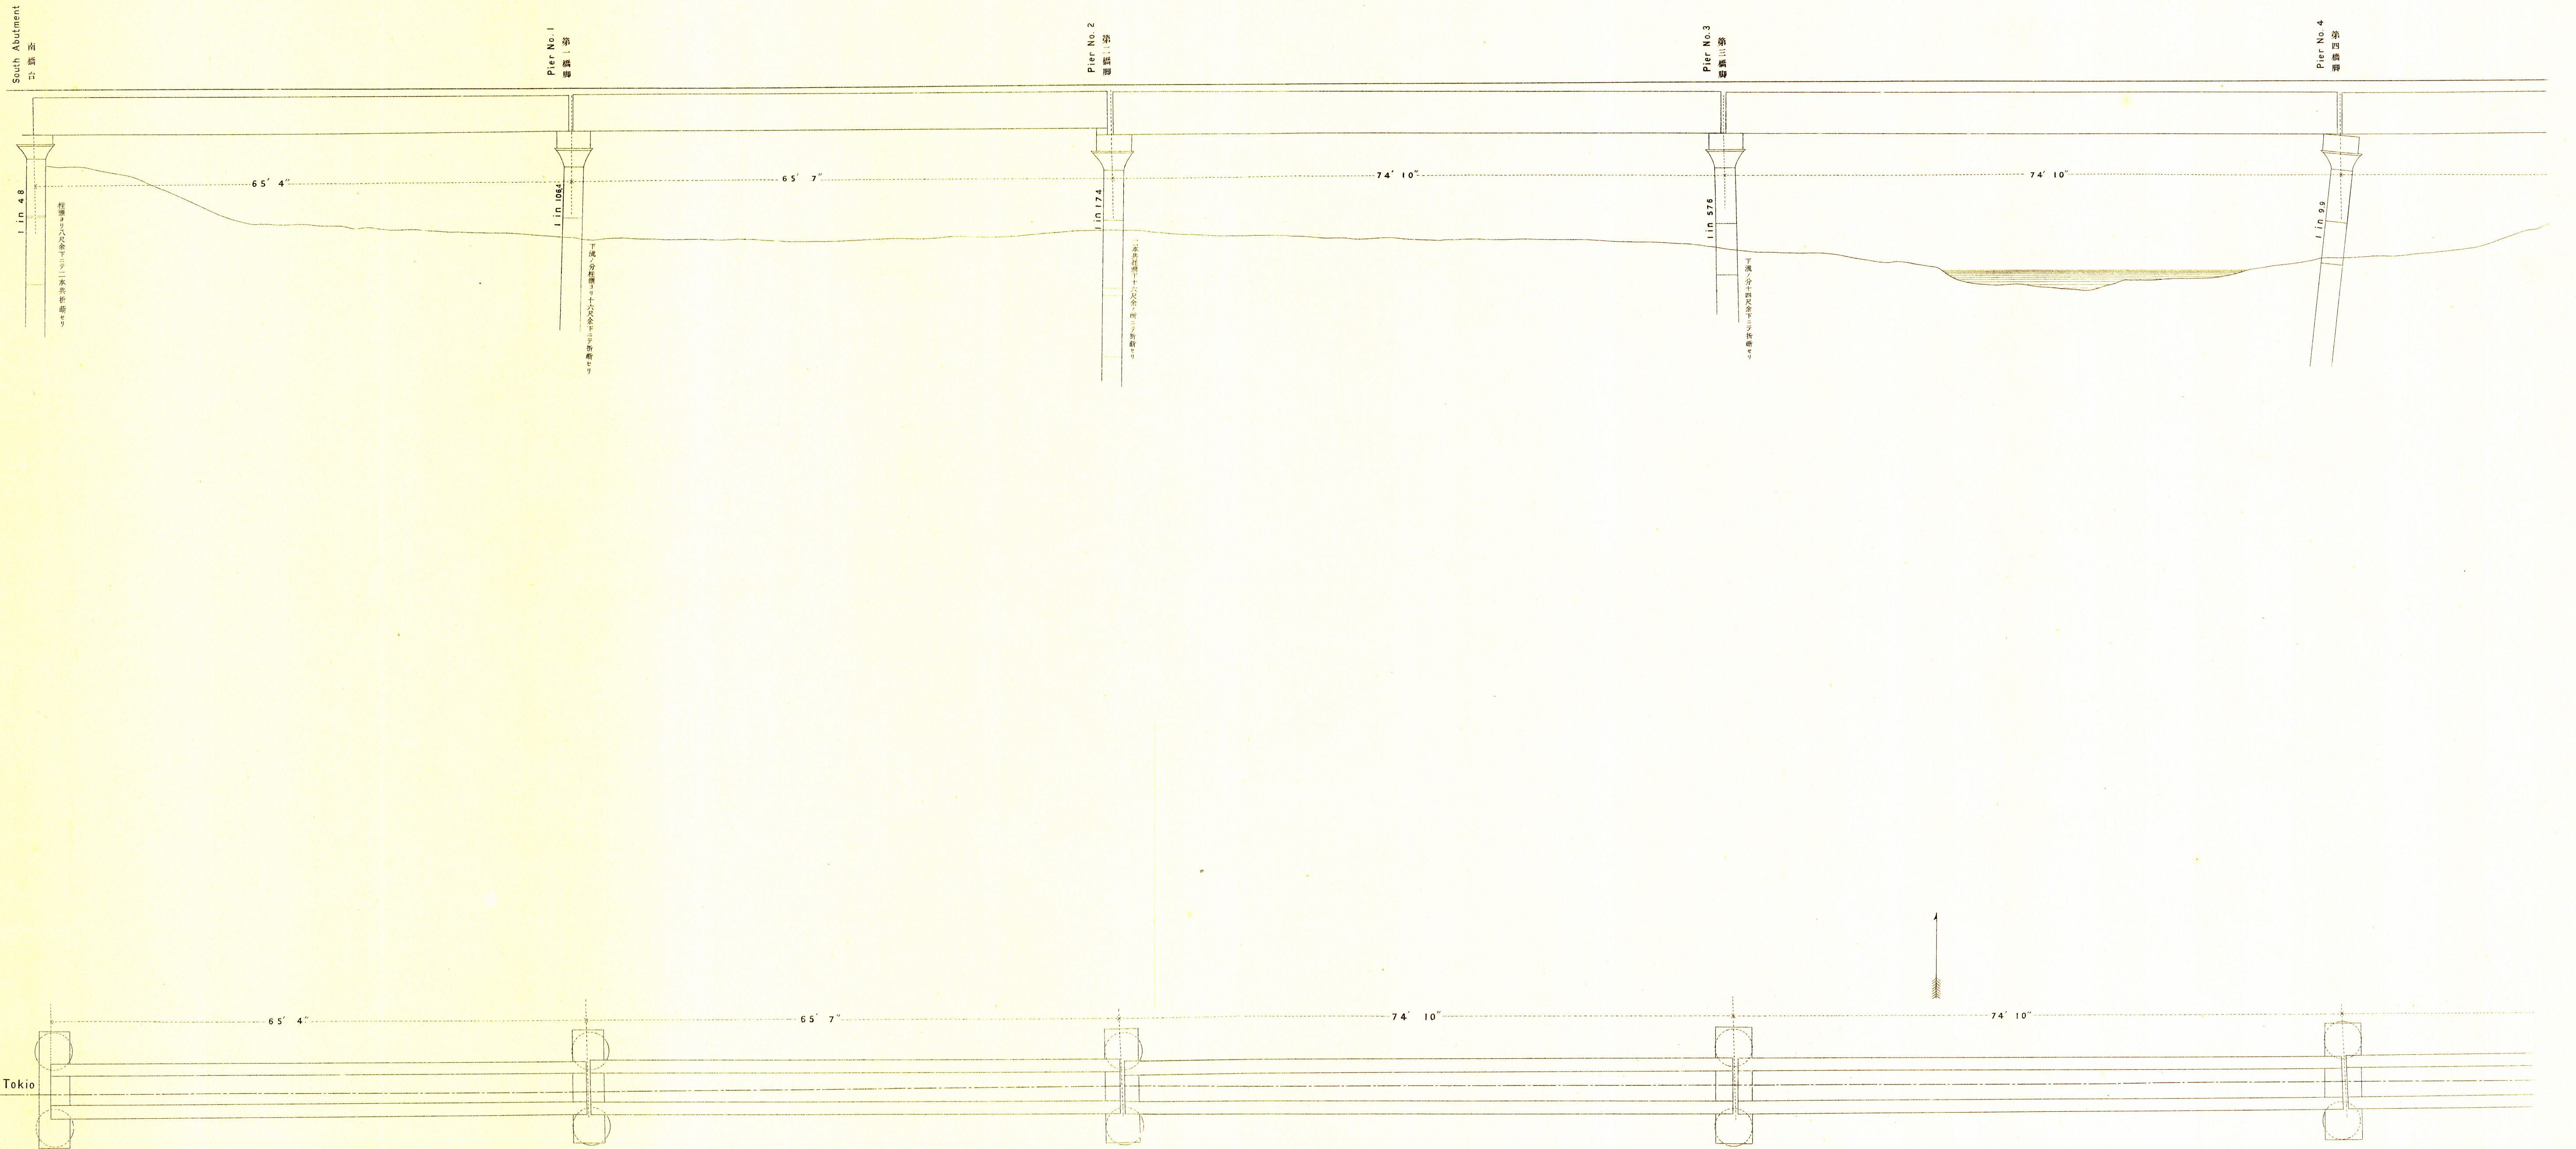

BRIDGE.


1891.

near the surface or underneath the ground.

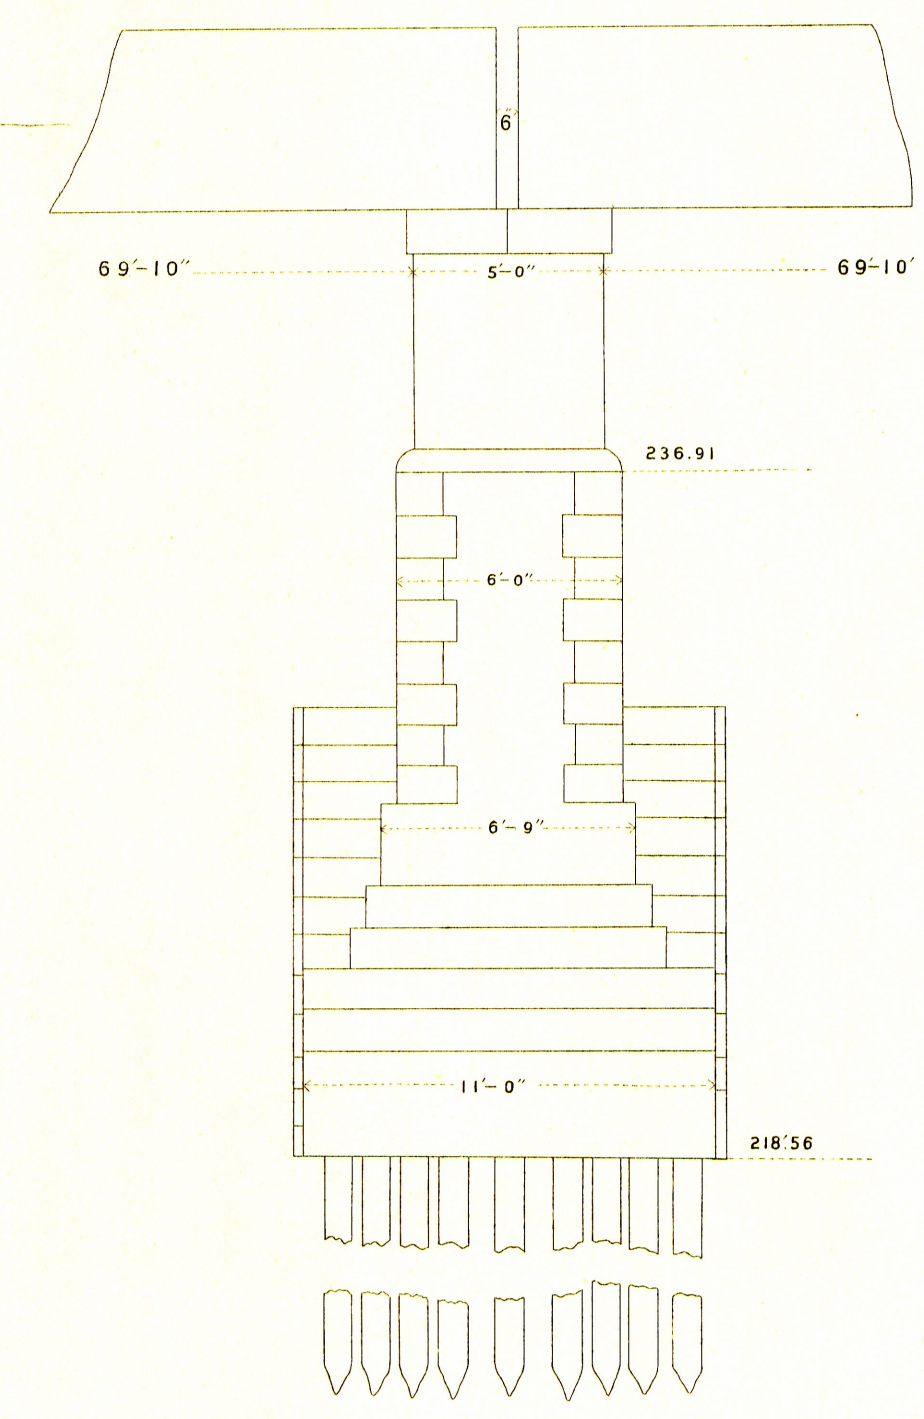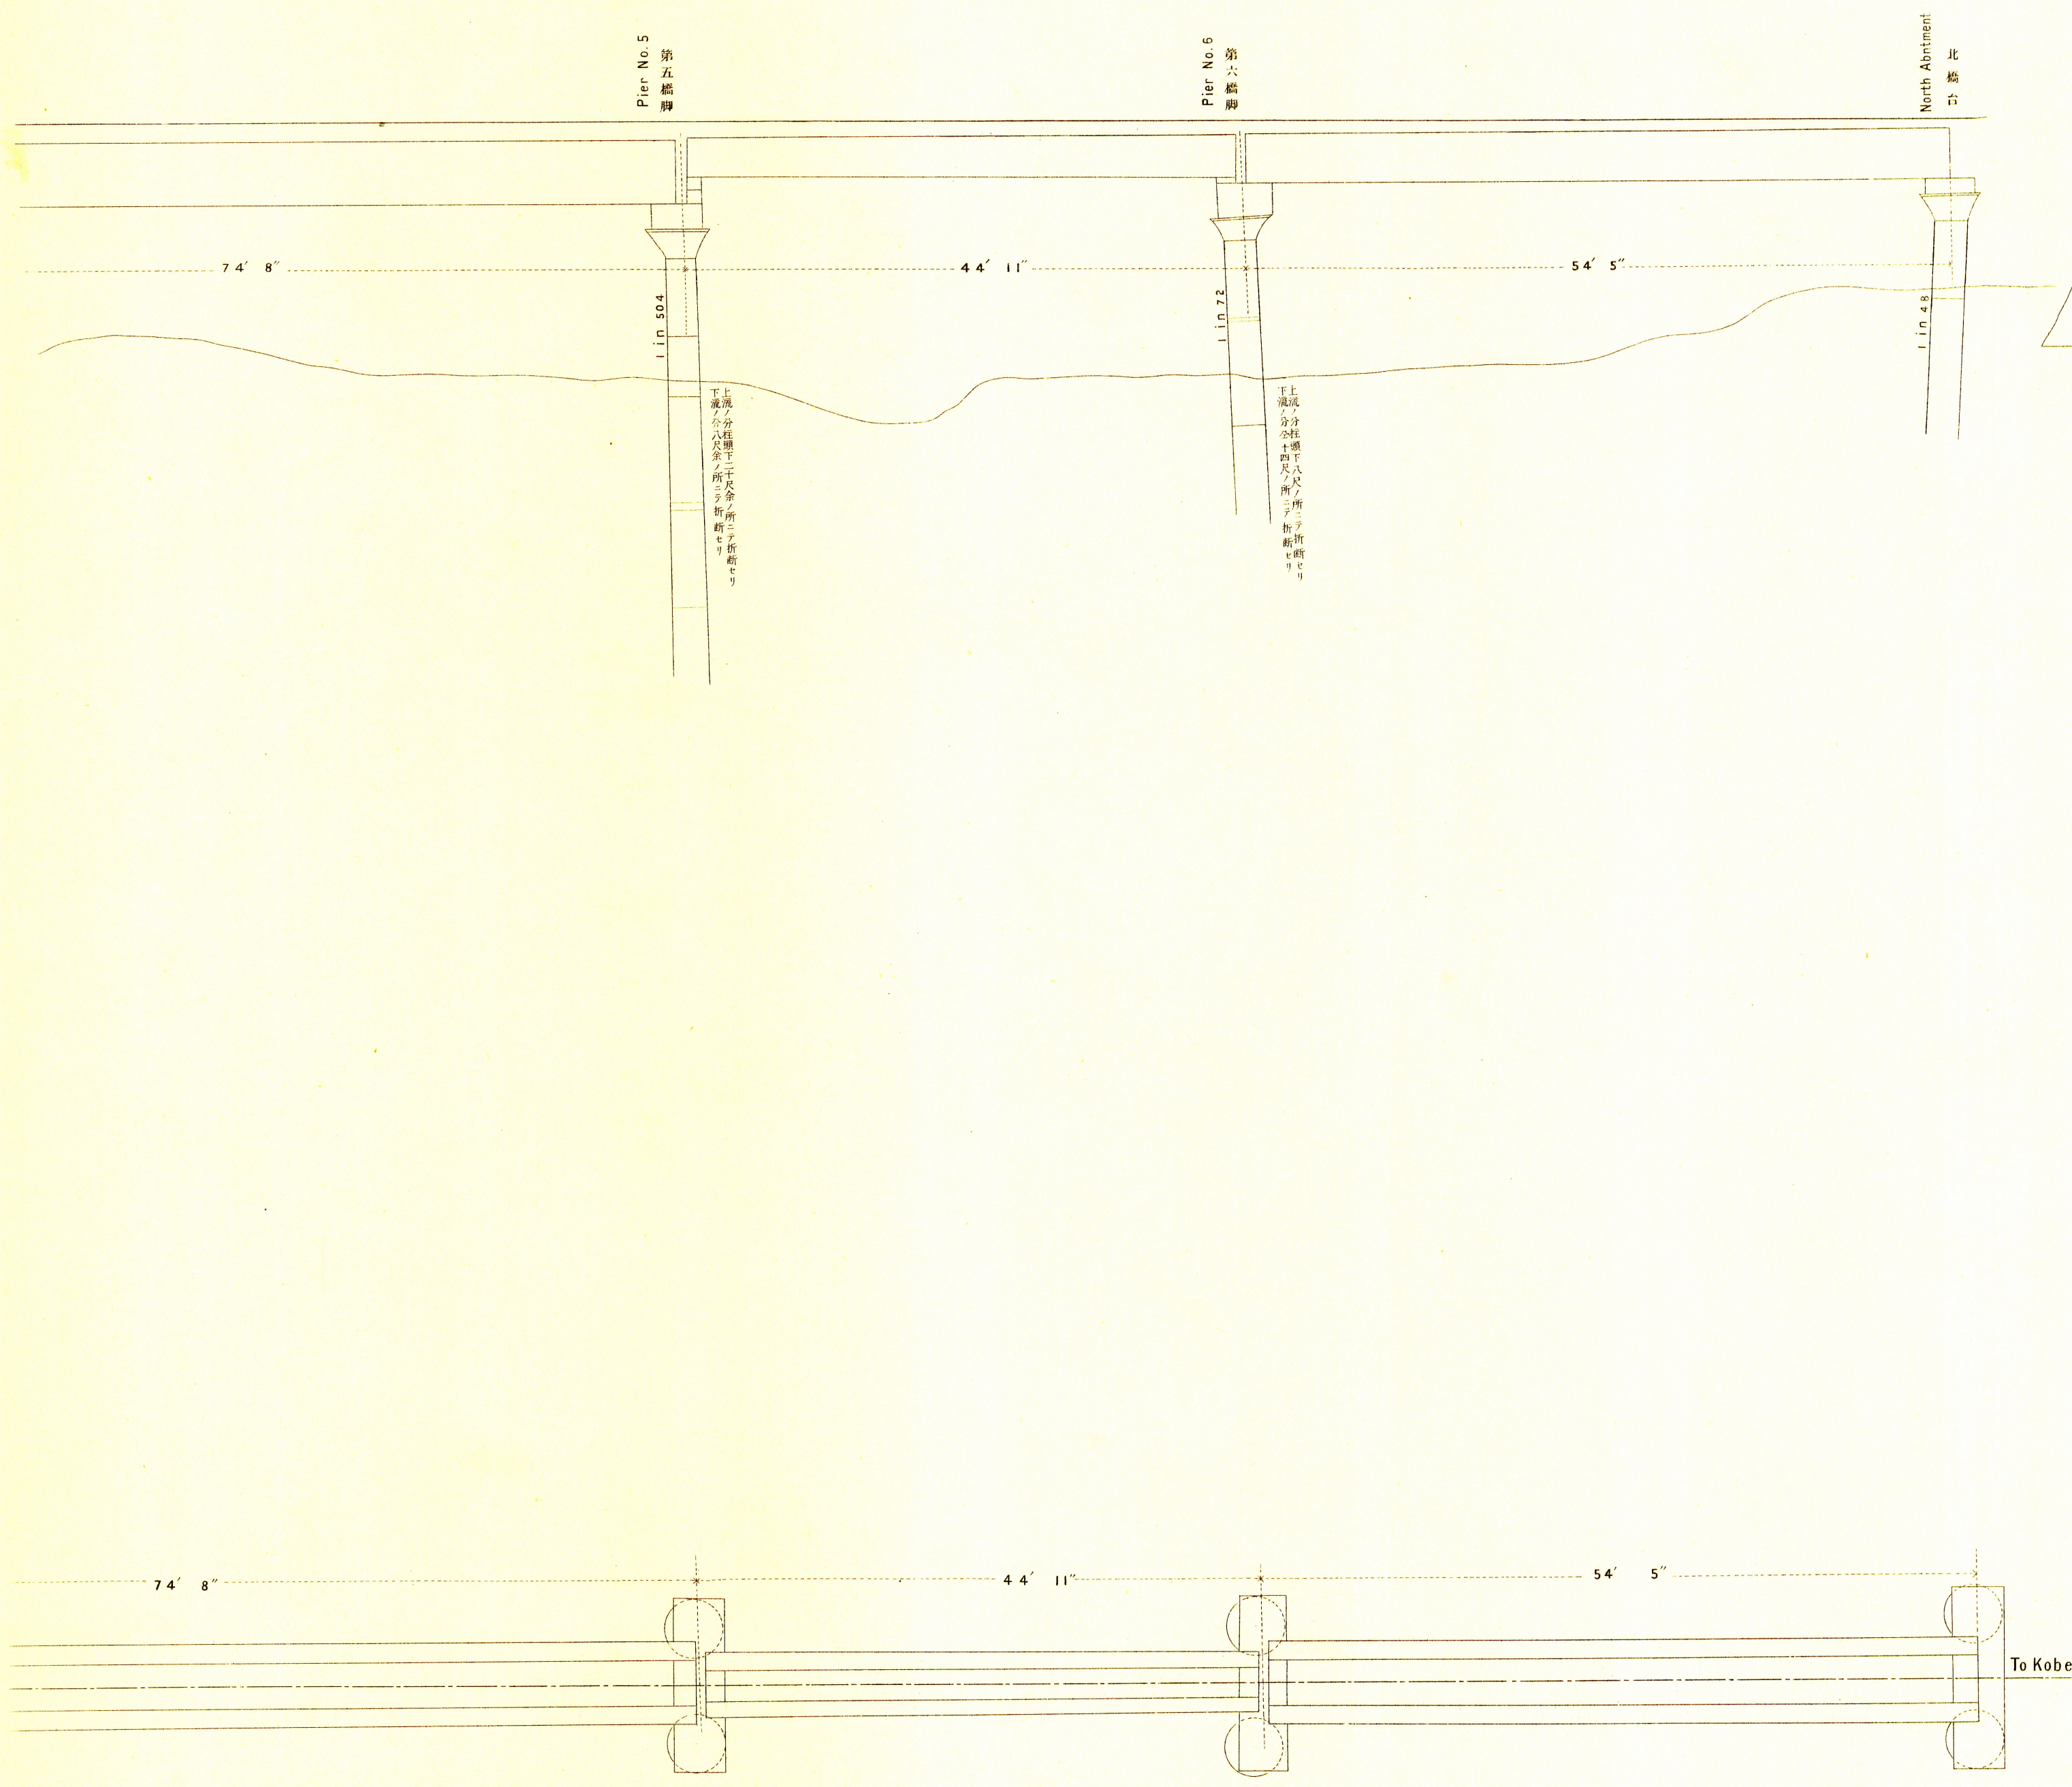

PLAN & ELEVATION OF PIER No. 3.

As reconstructed after the earthquake disaster of
Oct. 28th, 1891.

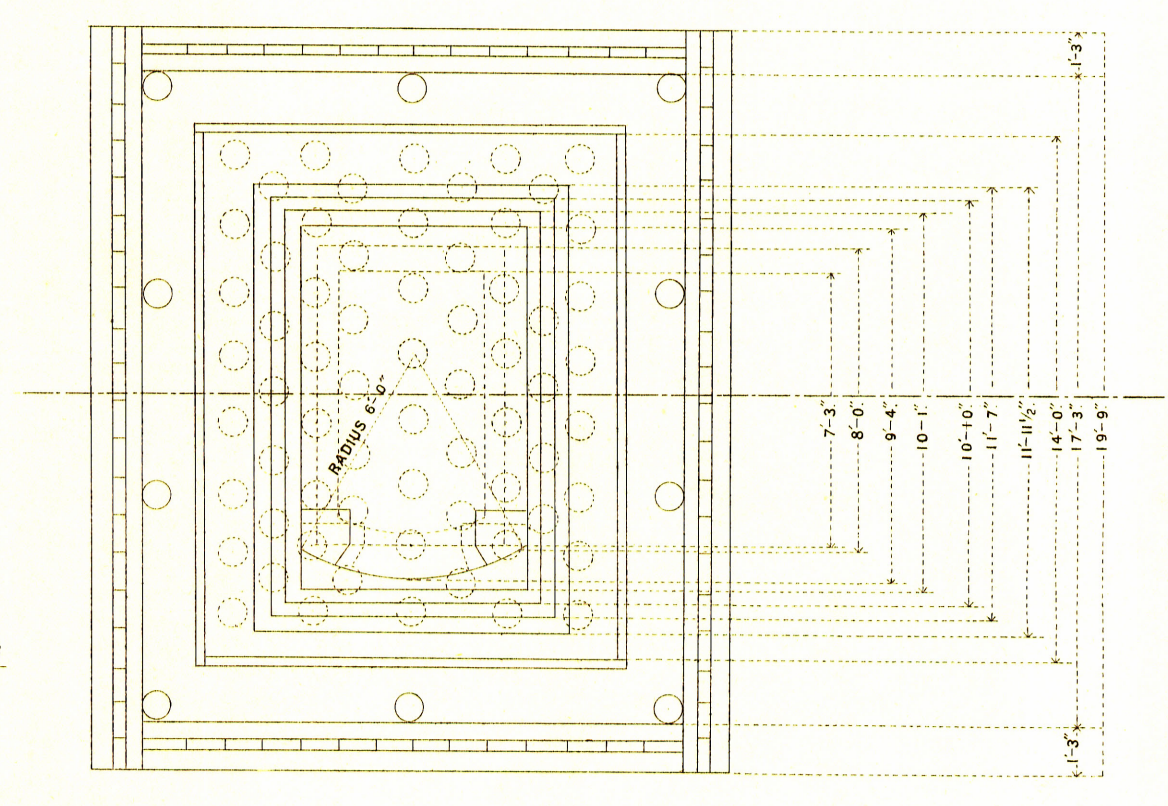

Scale: 5 ft. to an inch.

